

Service Bulletin

no. 14, 2008-04-08

Non-return valves for protection of air distributor

System applicability: Marinfloc CD units

Background

We have experienced damages to the air distributor in the electric cabinet caused by water penetration on some vessels. This has been caused by leakage of the non-return valve no. 137 on the circulation tank no. 52, see picture no. 1.

- Non-return valve ¼" no. 137 article no. 16101

Corrective action

In order to avoid and correct this problem, Marinfloc recommends that the non-return valve is checked for leakage and replaced if necessary. Marinfloc also recommends that an extra non-return valve is added to the hose after the air adjustment valve no. 136 for extra safety, see picture no. 2.

- Non-return valve 4 mm for hose article no. 47206


If your CD unit is not equipped with this 4 mm non-return valve for hose or with thread, see picture no. 3, Marinfloc AB will supply one free of charge ex. Works Varekil, Sweden



Picture 1.
Non-return valve ¼" (no. 137)
Article no. 16101



Picture 2.
Non-return valve 4 mm
Article no. 47206

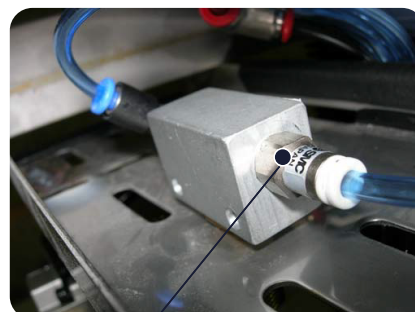

Picture 3.
Non-return valve 4 mm with thread
Article no. 47207

All previous service bulletins and other important information, e.g. updated lists of approved chemicals and flocculants, can be found on our website www.marinfloc.com