


Assembly & Installation Instructions

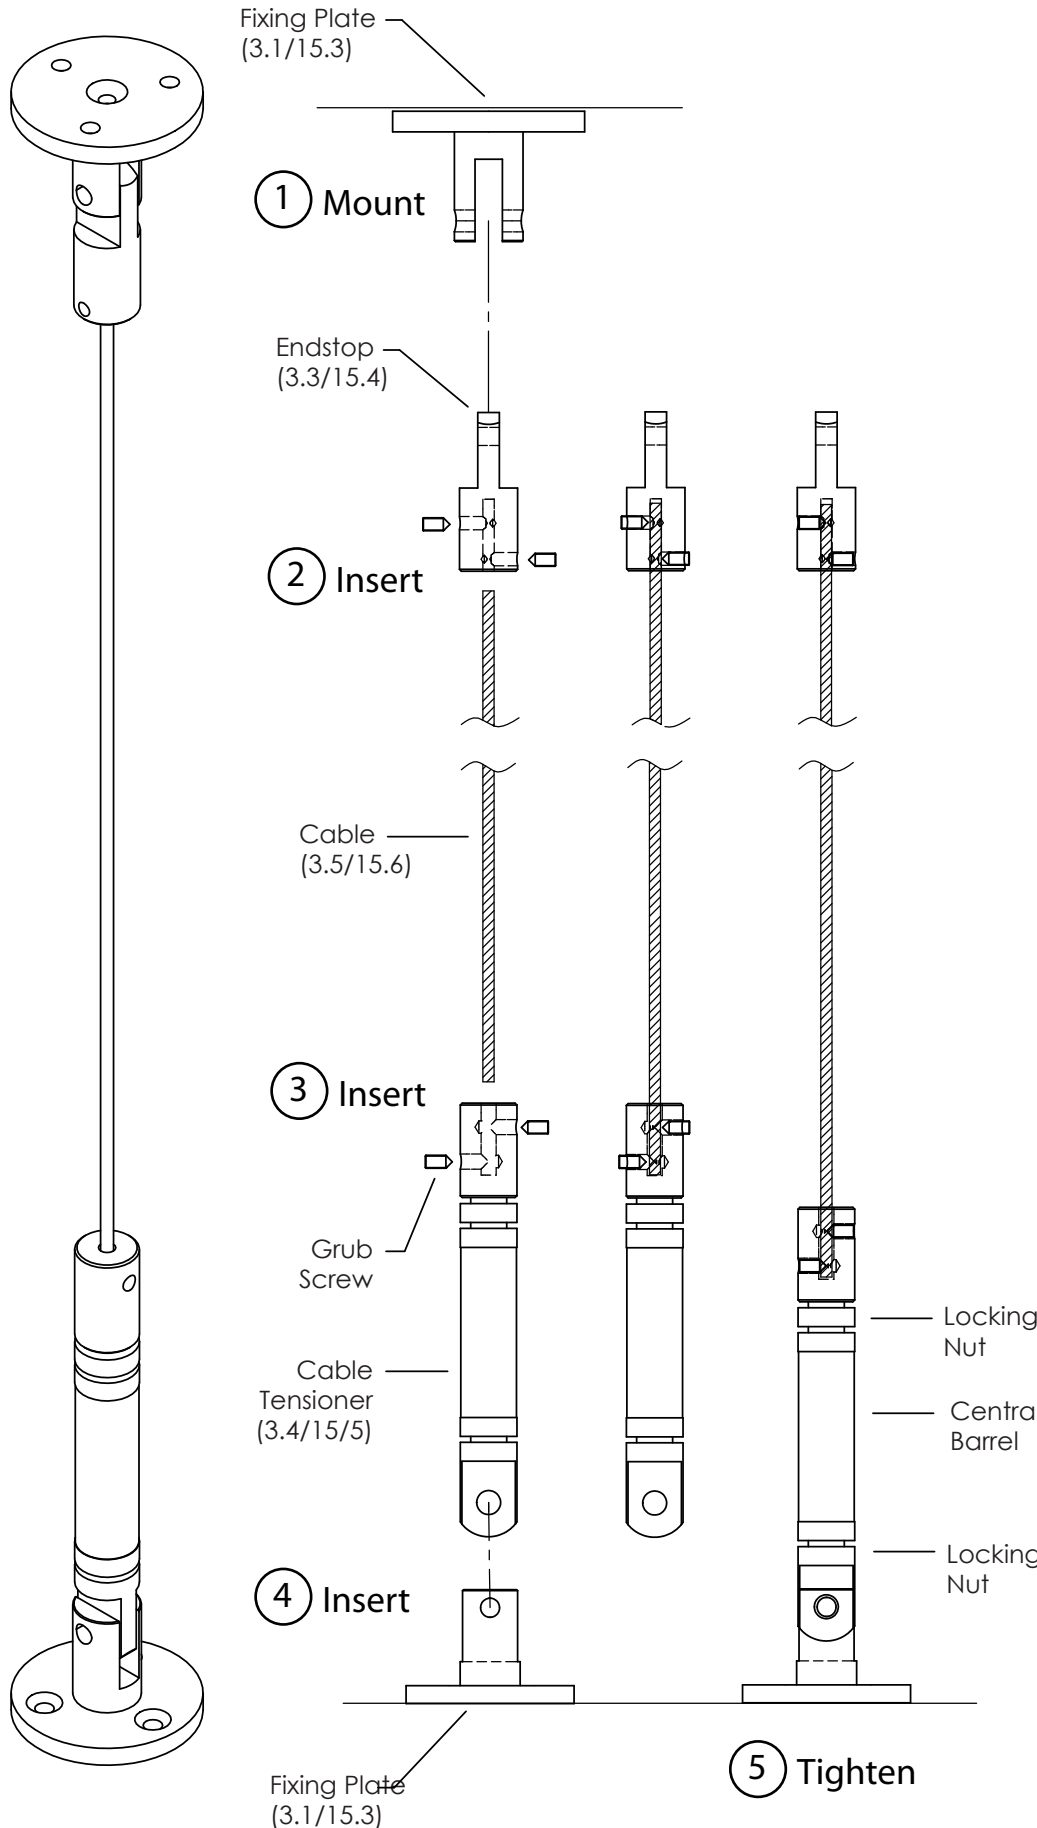

6.1 : CABLE MAXI/MINI

Floor to Ceiling

Measure from the floor to the ceiling and then subtract 6 1/2". Cut Cable (3.5/15.6) to corrected measurement.

1. Mount- Attach Fixing Plates to the ceiling and floor blocking using #8 screws (supplied by others).

2. Insert- Cable into the Endstop making sure the cable passes behind both Grub Screws, tighten securely. Insert End Stop into ceiling Fixing Plate, tighten Grub Screws until secure.

3. Insert- Cable into End Fixing of Cable Tensioner making sure the cable passes behind both Grub Screws, tighten securely.

4. Insert- Making sure the Cable Tensioner is fully extended, insert into the Floor Fixing Plate, tighten Grub Screws.

5. Tighten- Rotate central barrel of Cable Tensioner clock-wise until the Cable is at the desired tension. Using the two Locking Nuts (above and below the central barrel) tighten against the central barrel.

Max load (if installed correctly):
Mini Cable & Tensioner - 140 Kg
Maxi Cable & Tensioner - 200 Kg

Torque Spec:
5mm Hex Grub Screw - 3.5 Nm
(hand tight with 3mm Allen key)

PLEASE NOTE: DO NOT overtighten picture panel/shelf grips, as this may cause damage to the cable.

It is important to add adequate blocking to hold desired display weight loads. Questions? Please contact your B&N representative.

APPROVED
By dwilliams at 12:02 pm, Nov 24, 2010



B&N INDUSTRIES
650.593.4127
WWW.BNIND.COM