


<p>Allied Feather and Down Corporation 6905 W Acco Street Building A Montebello, California 90640 United States</p>	<p>3-Day Arrival Date: Wed 12 May 2021 Report Date: Fri 14 May 2021 Content Retest Report Date: Mon 24 May 2021 Fill Power Retest Report Date: Mon 24 May 2021 Content Revised Report Date: Tue 1 June 2021 Fill Power Revised Report Date: Tue 1 June 2021</p>
--	---

Sample Type: Plumage
Shipped By: FedEx 784965208114
Sample Identification: 0521179

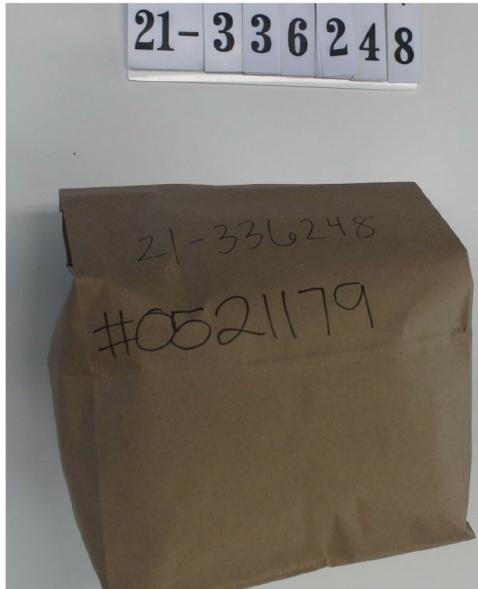

This analysis represents (within normal testing variances) the test results from the sample(s) submitted. The analysis may not represent the entire lot, batch or production run. In no event shall IDFL be responsible or liable for any direct, indirect, punitive, incidental, special, or consequential damages whatsoever arising out of or connected with the use of, misuse of, or reliance upon such results or analysis. This test report is subject to the Terms and Conditions found at www.idfl.com.

IDFL LABORATORY AND INSTITUTE

IDFL SALT LAKE
1455 South 1100 East
Salt Lake City, UT 84105
USA
+1 801 467 7611
info@idfl.com

IDFL EUROPE AG
Zürcherstrasse 282
CH-8500 Frauenfeld
Switzerland
+41 52 765 1574
europe@idfl.com

IDFL CHINA
Tonghui Mid-Road 688, Xiaoshan
Hangzhou Zhejiang 311200
China
+86 571 8273 6561
china@idfl.com

IDFL TAIPEI
2F., No. 163 Sec. 2, Wenhua Rd.
Banqiao District, New Taipei City
Taiwan
+886 2 2259 1178
taiwan@idfl.com

IDFL VIETNAM
No. 8, B4 Street An Loi Dong Ward
District 2, Ho Chi Minh City
Vietnam
+84 282-244-7611
vietnam@idfl.com



Approved By

www.idfl.com

Client 46

SL

Sample 1 of 3



SALT LAKE

Test Report

0521179

IDFL # 21-336248

Allied Feather and Down Corporation

Tue 1 June 2021

Test Orders Summary

Test	Test Component	Result	Expected Value
Content IDFB Part 3 2020	Down Clusters	90.2%	
Steam Fill Power IDFB Part 10-B 2020	Final Fill Power Volume	820 in ³ /30g	
Oxygen IDFB Part 7 2013	Oxygen	3.2 mg/100g	
Turbidity IDFB Part 11 2013	Turbidity Glass Tube	1000 mm	
Fat and Oil IDFB Part 4 2013	Fat and Oil	1.0%	

This analysis represents (within normal testing variances) the test results from the sample(s) submitted. The analysis may not represent the entire lot, batch or production run. In no event shall IDFL be responsible or liable for any direct, indirect, punitive, incidental, special, or consequential damages whatsoever arising out of or connected with the use of, misuse of, or reliance upon such results or analysis. This test report is subject to the Terms and Conditions found at www.idfl.com.

IDFL LABORATORY AND INSTITUTE

IDFL SALT LAKE
 1455 South 1100 East
 Salt Lake City, UT 84105
 USA
 +1 801 467 7611
info@idfl.com

IDFL EUROPE AG
 Zürcherstrasse 282
 CH-8500 Frauenfeld
 Switzerland
 +41 52 765 1574
europe@idfl.com

IDFL CHINA
 Tonghui Mid-Road 688, Xiaoshan
 Hangzhou Zhejiang 311200
 China
 +86 571 8273 6561
china@idfl.com

IDFL TAIPEI
 2F., No. 163 Sec. 2, Wenhua Rd.
 Banqiao District, New Taipei City
 Taiwan
 +886 2 2259 1178
taiwan@idfl.com

IDFL VIETNAM
 No. 8, B4 Street An Loi Dong Ward
 District 2, Ho Chi Minh City
 Vietnam
 +84 282-244-7611
vietnam@idfl.com

Approved By

www.idfl.com

Client 46

SL

Sample 1 of 3



SALT LAKE

Test Report

0521179

IDFL # 21-336248

Allied Feather and Down Corporation

Tue 1 June 2021

Content IDFB Part 3 2020

Down Clusters	90.2%
Down Fibers	2.4%
Waterfowl Feather Fibers	2.3%
Waterfowl Feathers	4.7%
Broken and Damaged Waterfowl Feathers	0.2%
Quill	0.0%
Landfowl	0.0%
Residue	0.2%
Total	100.0%

Steam Fill Power IDFB Part 10-B 2020

Height	207 mm/30g
Volume	820 in ³ /30g

Oxygen IDFB Part 7 2013

Oxygen	3.2 mg/100g
--------	-------------

Turbidity IDFB Part 11 2013

Turbidity Glass Tube	1000 mm
Turbidity NTU	1.05 NTU

Fat and Oil IDFB Part 4 2013

Fat and Oil	1.0%
-------------	------

This analysis represents (within normal testing variances) the test results from the sample(s) submitted. The analysis may not represent the entire lot, batch or production run. In no event shall IDFL be responsible or liable for any direct, indirect, punitive, incidental, special, or consequential damages whatsoever arising out of or connected with the use of, misuse of, or reliance upon such results or analysis. This test report is subject to the Terms and Conditions found at www.idfl.com.

IDFL LABORATORY AND INSTITUTE

IDFL SALT LAKE
 1455 South 1100 East
 Salt Lake City, UT 84105
 USA
 +1 801 467 7611
info@idfl.com

IDFL EUROPE AG
 Zürcherstrasse 282
 CH-8500 Frauenfeld
 Switzerland
 +41 52 765 1574
europe@idfl.com

IDFL CHINA
 Tonghui Mid-Road 688, Xiaoshan
 Hangzhou Zhejiang 311200
 China
 +86 571 8273 6561
china@idfl.com

IDFL TAIPEI
 2F., No. 163 Sec. 2, Wenhua Rd.
 Banqiao District, New Taipei City
 Taiwan
 +886 2 2259 1178
taiwan@idfl.com

IDFL VIETNAM
 No. 8, B4 Street An Loi Dong Ward
 District 2, Ho Chi Minh City
 Vietnam
 +84 282-244-7611
vietnam@idfl.com

Approved By

www.idfl.com

Client 46

SL

Sample 1 of 3